





Dan Inabnitt

Kentucky
Transportation
Cabinet

Division of Planning


Sensors

- · Capacitance Mat
- · Rigid Channel Piezo
- · Bare Piezo
- · Bending Plate
- · Load Cell

Capacitance Mat

- · Do wear out.
- · Water destroys.
- · Use permanent loops if possible.
- · Use Tap-Con screws
- · Lots of bitchethene tape

Capacitance Mat

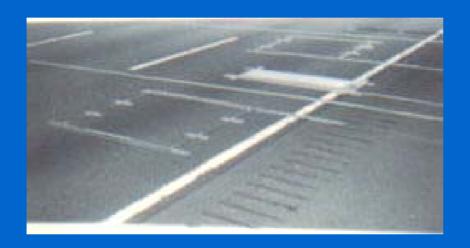

Typical Mat installations




- Stay in concrete well
- Need good grout
- Tend to pop out of pavement especially rutted asphalt
- Not easily "held" in slot during epoxy cure time



This sensor has been working for more than six years!



This sensor has not.

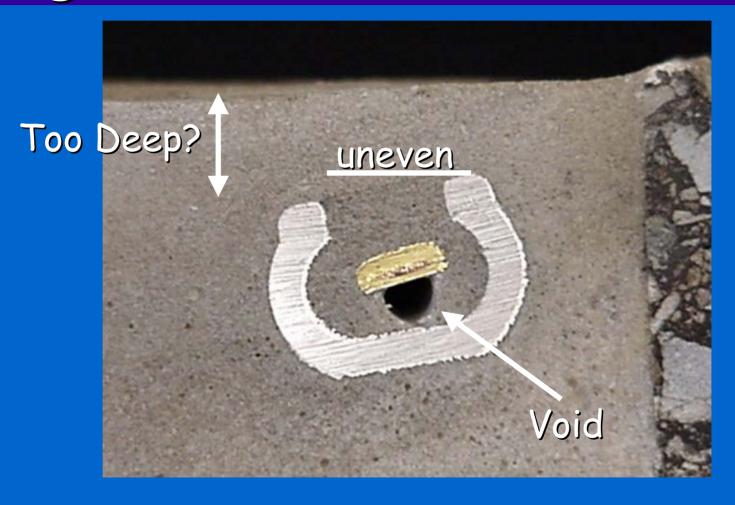




Bare Piezo


- Easily installed
- Installs quickly
- Small saw slot
- · Can be used in portable applications

Bare Piezo

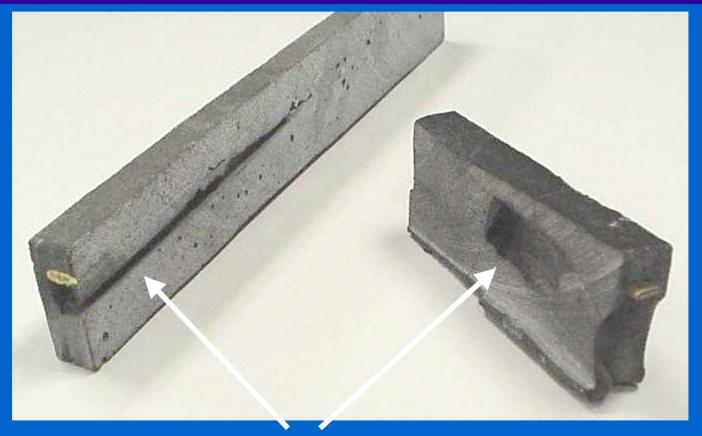

voids

Bare Piezo

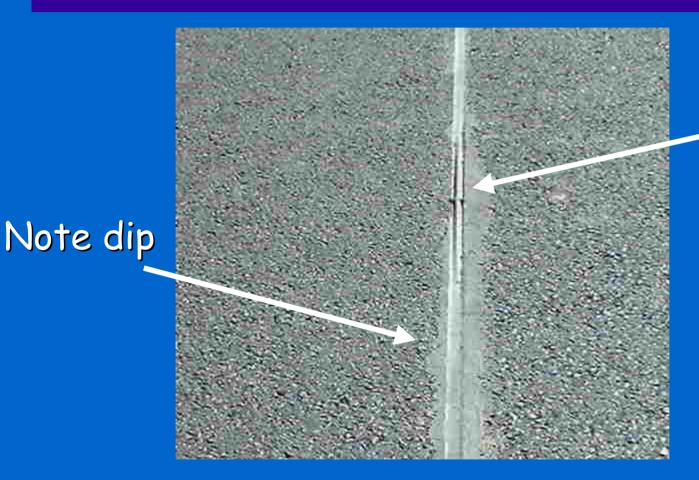

Note void

Bending Plate - Load Cell


- Have plenty of finishers available when using 'high-early" concrete
- Don't pour concrete directly on frames
- Pour sides and vibrate
- Tie rebar tight
- Make sure water drains to the ditch and not to the cabinet through conduit

Bending Plate - Load Cell

- Always make sure you tamp the bottom of the pit
- Use joint sized epoxy coated rebar
- Don't bore under asphalt to concrete
- Don't expect a more expensive WIM systems to compensate for poor road characteristics

Bending Plate



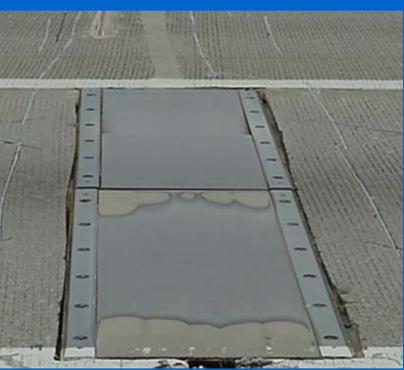

Typical Bending Plate installations

Load Cell





Typical Load-cell installations

Three types of installed sensors

The Good


- · Work all the time
- Have worked for years
- Doesn't matter what the installation looks like

The Bad

- Don't work
- Can't get it to work
- Doesn't matter what the installation looks like

Common to all The Ugly

- Only works when you are there
- Checks out OK
- · The installation usually looks good

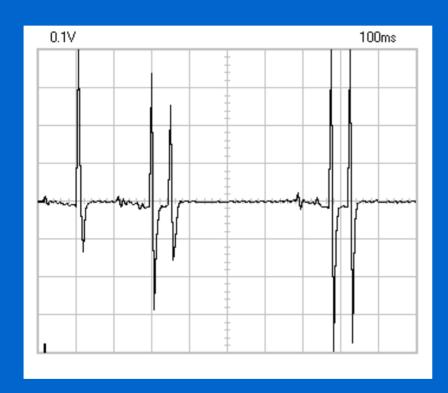


Invest in a good Digital Storage Oscilloscope



Roadway Considerations

- Straight
- · Smooth
- · Level
- · "Good" surface
- · No rutting
- · ASTM WIM spec

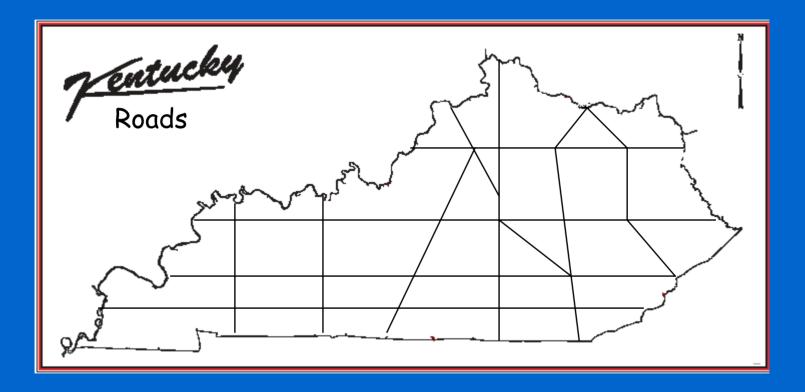

Installation

- · Have detailed plans
- · Have an "expert" on site
- · Keep future repairs in mind



Note all lead-in slots converge to one point.

This makes future installations and repairs difficult.







Run lead-in Straight to pull box




Don't forget maintenance to other components at site.

Plan the work

- Know where everything is going to go
- Mark all saw cuts
 before starting the saw
- The more wires in a slot,
 the deeper it has to be

Plan the work

- Accurately measure/layout straight lines perpendicular to traffic flow
- · Cut accurate, straight slots
- · Always "wet" cut

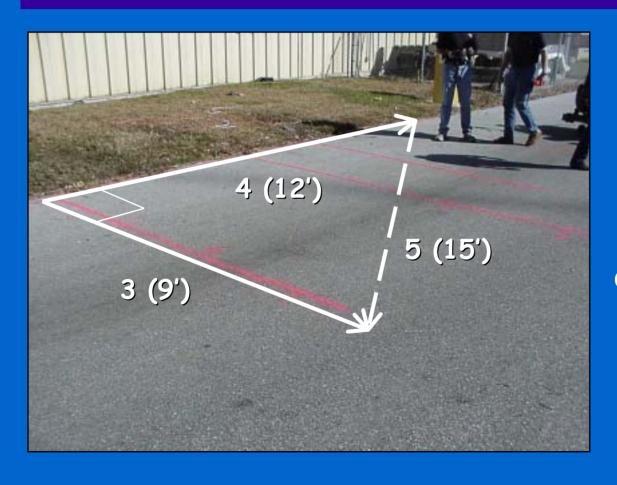

Don't just "eyeball it". Measure it! It can be easily accomplished constructing 3-4-5 triangle.



Then dry with oil free compressed air

Use wire brush




Sensor crossings should be 1-2mm high, lightly feathered. NO DIPS!!! (Dip = Loss of Signal)

The contractor didn't smile...



when he had to replace this "smile".

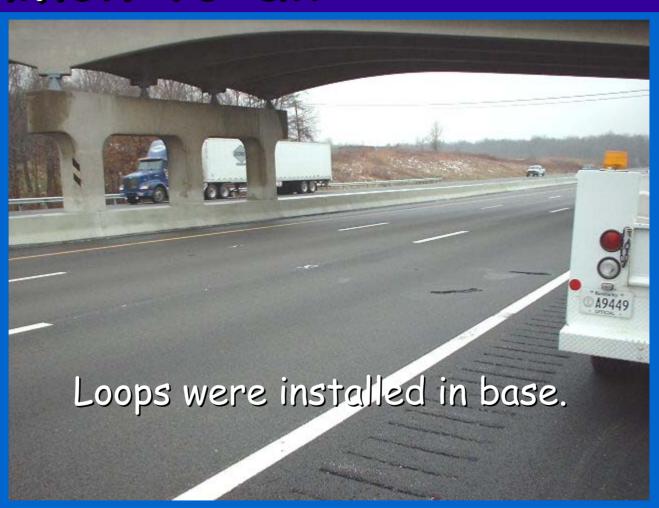



When driving surface was put down it did not adhere to loop sealant. Neatness counts.

Future Directions

Fiber Optic sensors

Piezo-quartz

• ??

Thank